




SAFETY NOTICE

powerCON® TRUE1

- Regularly check the condition of your powerCON TRUE1 connector system (cable connector & chassis) for clear signs of wear and tear.
- Through improper use and the excessive use of force, the encoding lugs and guide slots in the connector system can become so severely worn or damaged that it is possible to insert the cable connector the wrong way. However, when inserted the wrong way, the cable connector are not to twist into place.
- A cable connector/plug connector inserted the wrong way can lead to contact between live wires and the grounding contact in the plug socket.
- To determine that the cable connector/plug connector is inserted correctly, follow the use instructions and listen for the "click" when performing the twist-lock. Immediately unplug any connector that does not twist-lock correctly in place.

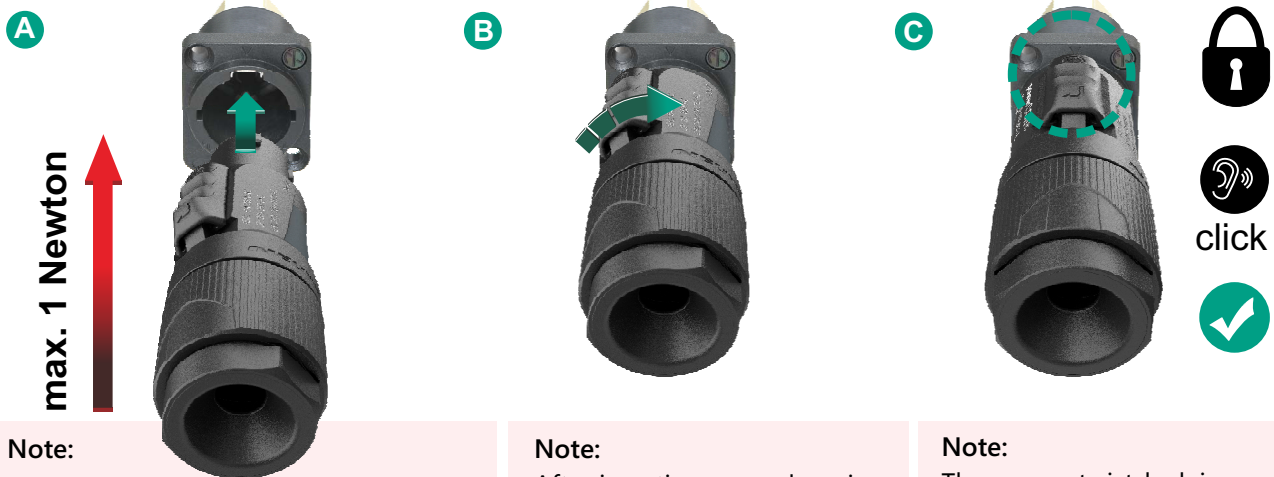

Note:

When connecting, match the notch on the cable connector to the corresponding guide slot on the chassis.

Note:

After inserting properly as in illustration **A**, twist the cable connector clockwise to lock.

Note:

The proper twist-lock is achieved when the silvery tab is in the position shown in **C** and an audible «click» is heard.



SAFETY WARNING

incorrect insertion may cause electrical contact misalignment resulting in equipment malfunction and/or personal injury.

The manufacturer of cord sets and of interconnection cord sets is responsible for the conformity assessment according to the applicable regulatory documents.



Draft. Nr.: BDA 722 V1
Update: 2024-11-07



Neutrik AG | LI-9494 Schaan

www.neutrik.com

Data subject to change without prior notice. © 2024 NEUTRIK®, NEUTRIK®, powerCON® are registered trademark of Neutrik AG. ALL RIGHTS RESERVED.






powerCON® TRUE1

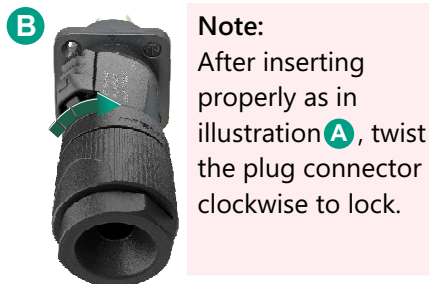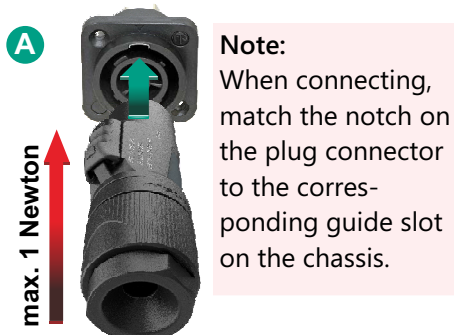

SAFETY WARNING

incorrect insertion may cause electrical contact misalignment resulting in equipment malfunction and/or personal injury.

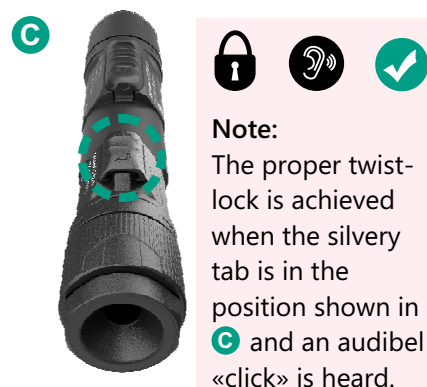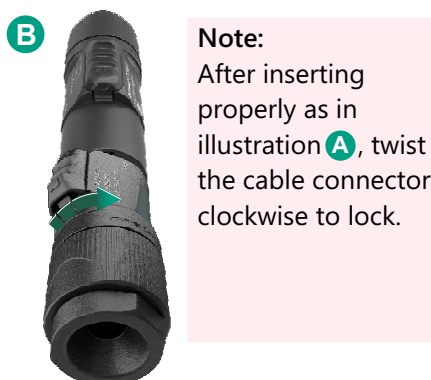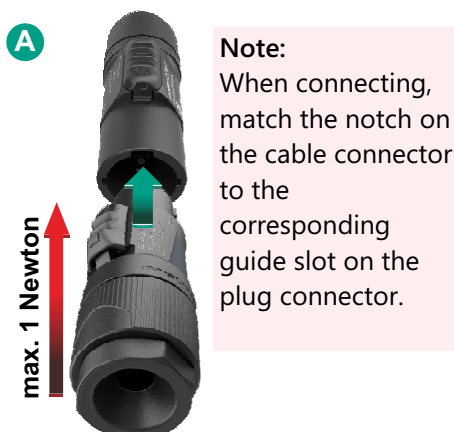

SAFETY WARNING

incorrect insertion may cause electrical contact misalignment resulting in equipment malfunction and/or personal injury.

The manufacturer of cord sets and of interconnection cord sets is responsible for the conformity assessment according to the applicable regulatory documents.



Draft. Nr.: BDA 722 V1
Update: 2024-11-07

Neutrik AG | LI-9494 Schaan

www.neutrik.com

Data subject to change without prior notice. © 2024 NEUTRIK®, NEUTRIK®, powerCON® are registered trademarks of Neutrik AG. ALL RIGHTS RESERVED.